

Panel Cutout Adapter Installation Guide <https://www.pro-face.com>

This product is a conversion kit for replacing your current display unit with a display unit that has smaller panel cutout dimensions.

	Before	After
Panel cutout adapter for 7-inch wide display unit	W 204.5 x H 159.5 mm (W 8.05 x H 6.28 in)	W 190 x H 135 mm (W 7.48 x H 5.31 in)
Product Number: PFXZHAT4W1		

Package Contents

Verify all items listed here are present in your package.
Please contact customer support immediately if you find anything damaged or missing.

- A: Attachment x 1
- B: Attachment gasket x 1
- C: Installation fastener x 4
- D: M4 Hex nut x 6 (including 2 spares)
- E: Installation guide (this sheet) x 1

Specifications

Installation Requirements	Protective Construction	Protection: Equivalent to IP65 (Front face of installed unit)
	Weight	0.2 kg (0.44 lb) or less (Attachment only)
	External Dimensions (W x H x D)	218 x 173 x 17 mm (8.58 x 6.81 x 0.67 in)
Material		Steel sheet (SUS304)

Installation

Step

1. Make sure that the installation gasket (E) is fitted properly to the display unit (F).
2. Install the attachment gasket (B) to the attachment (A).
3. Install the attachment prepared in Step 2 to the display unit.
4. Attach the installation fasteners (C) and tighten the screws in the right direction using a Phillips screwdriver. The necessary torque is 0.5 N•m (4.4 lb•in).
5. Insert the display unit prepared in Step 4 into the the cutout from the front side of the installation panel.
6. Tighten the M4 hex nuts (D) evenly. The necessary torque is 0.5 N•m (4.4 lb•in).

NOTICE

BROKEN ENCLOSURE



Do not exert more torque than the amount specified when tightening the screws and nuts.
Failure to follow these instructions can result in equipment damage.

The information in this document is subject to change without notice.
© 2024.12 Schneider Electric Japan Holdings Ltd. All Rights Reserved.
4-4-9 Kitahama, Chuo-ku, Osaka 541-0041 JAPAN
NAT10992 00 Printed in
This paper is made from over 70% recycled materials.




Pro-face
by Schneider Electric

Completion Drawing

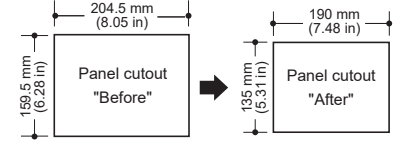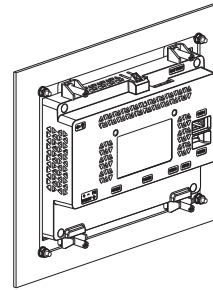

- (A) Attachment
- (B) Attachment gasket
- (C) Installation fastener
- (D) M4 Hex nut

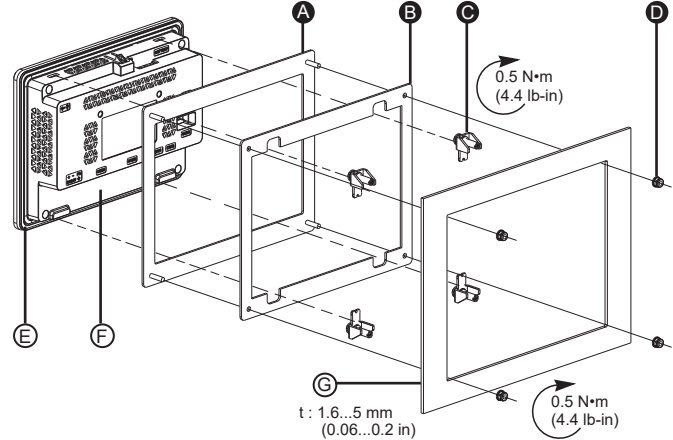

- (E) Installation gasket (attached to a display unit)
- (F) Display unit
- (G) Panel

アタッチメント取扱説明書

<https://www.proface.co.jp>

本製品は従来ご使用の表示器からパネルカット寸法の小さな表示器への置き換えを行うためのアタッチメントです。

7型ワイドモデル用アタッチメント
型式: PFZXHAT4W1

置き換え前	置き換え後
W 204.5 x H 159.5 mm (W 8.05 x H 6.28 in)	W 190 x H 135 mm (W 7.48 x H 5.31 in)

梱包内容

梱包箱には以下のものが入っています。ご使用前に必ず確認してください。
万一破損や部品不足がありましたら、直ちに弊社カスタマーセンターまでご連絡ください。

- A: アタッチメント x 1
B: アタッチメントガasket x 1
C: 取り付け金具 x 4
D: M4六角ナット x 6 (予備2個を含む)
E: 取扱説明書(本書) x 1

仕様

設置条件	保護構造	保護: IP65相当 (パネル埋め込み時のフロント面)
	質量	0.2 kg (0.44 lb) 以下 (アタッチメントのみ)
	外形寸法 (W x H x D)	218 x 173 x 17 mm (8.58 x 6.81 x 0.67 in)
材質	鋼板 (SUS304)	

取り付け

手順

- 防滴ガasket(E)が表示器(F)に正しく取り付けられているか確認します。
- アタッチメントガasket(B)をアタッチメント(A)に取り付けます。
- 手順2で準備したアタッチメントを表示器に取り付けます。
- 取り付け金具(C)を取り付け、プラスドライバーを使用してネジを正しい方向に締めます。適正な締め付けトルクは0.5 N・m (4.4 lb・in)です。
- 手順4で準備した表示器を、取り付けパネルの前面側から開口部に挿入します。
- M4六角ナット(D)を均等に締めます。適正な締め付けトルクは0.5 N・m (4.4 lb・in)です。

注意

エンクロージャーの破損



ネジやナットを締める際は、指定以上のトルクをかけないでください。

上記の指示に従わないと、機器の損傷を負う可能性があります。


本書の記載事項はお断りなく変更することがありますのでご了承ください。
© 2024.12 Schneider Electric Japan Holdings Ltd. All Rights Reserved.
541-0041 大阪市中央区北浜 4-4-9
NAT10992 00

Pro-face™
by Schneider Electric

完成図

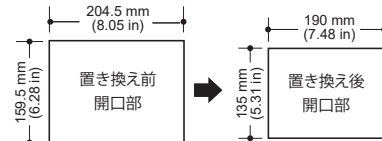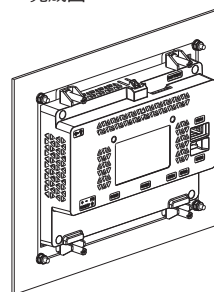

- (A) アタッチメント
(B) アタッチメントガasket
(C) 取り付け金具
(D) M4六角ナット

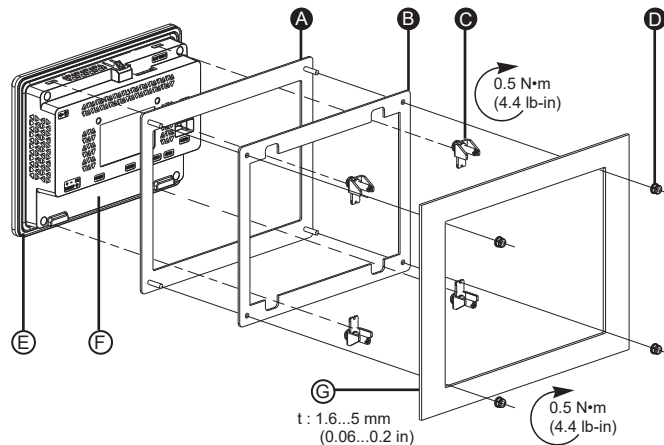

- (E) 防滴ガasket (表示器に装着)
(F) 表示器
(G) パネル